บทศัดยอ

การวิจัยมุ่งศึกษาการพัฒนาทางต้านการแต่งแร่ ของเหมืองแร่ทุ้งโพธิ์ โดยทำการ
วิเคราะห์และล่รูปผลการวิจัยของนักศึกษา 3 ครั้ง ในปี พ.ศ. 2520, พ.ศ. 2522 และ พ.ศ.
2524 จากนั้นจึงทำการศึกษาโรงแต่งแร่ในปัจจุบันอีกครั้งหนึ่ง

จากการศึกษาพบว่าในช่วงที่ใช้ล่ากตำแร่นั้น (ศึกษาในปี พ.ศ.2521-2522) สินแร่ ที่ป้อนไม่มีลูกคาบ ดีบุกปนควอรทซ์และการสู่ญเลียดีบุกไปกับหางแร่ของรางกู้แร่น้อย (ประมาณ 22%) ซึ่งเป็นขนาดที่เล็กกว่า 65 เมช่ลงไป โดยที่ล่วนใหญ่เป็นพวกที่มีขนาดเล็กกว่า 200 เมช่ (92 %) เมื่อเปิดทำเหมืองสู่บจากลานขึ้นร่ำก่าโดยแต่งด้วยตะแกรงหมุน จ๊กและโต๊ะสั่นนั้นสินแร่ที่ป้อนจะมี ขนาดค่อนข้างละเอียด (53 % เล็กกว่า 150 เมช่) และพบว่าดีบุกที่หนีไปกับหางแร่ของจ๊กเป็น พวกขนาดเล็กกว่า 65 เมช่ ลงไปเท่านั้น

หลังจากได้ปรับปรุงโรงแต่งแร่ใหม่และนำลินแร่มาจากหน้า เหมืองหาบ จากการศึกษา ในปี พ.ศ. 2524 พบว่าการสู่ญเสียดีบุกไปกับหางแร่ของจักมีมากถึง 42 % และ เมื่อศึกษาใหม่ครั้งนี้ พบว่า การสู่ญเสียดีบุกดังกล่าวยิ่งมากขึ้น (มากกว่า 60 %) โดยที่สู่ญเสียไปในทุกชั่วงขนาดของดีบุก และสามารถส่รุปสำเหตุได้ว่า เกิดจากการที่มีลูกคาบดีบุกปนควอรทซ์มาก ซึ่งไม่สามารถผ่านรูตะแกรงของจักได้ และอีกปัญหาหนึ่งคือ ปรากฏการณ์ "จักตาย" ก็เป็นสำเหตุหลักของการสู่ญเสียดีบุกเช่น เดียวกัน

Abstracts

This investigation aimed at the study of the development of dressing process in Tung po mine. After reanalysing and making the conclusion of three student projects reported in 1977, 1979 and 1981, the newly developed dressing plant was studied.

It is found that when gravity stamps were used (studied in 1978-1979) there is no locked tin-particle with quartz in the ore and tin losses to the palong tailings were not high (22%). When the old tailing dump was mined by gravel pump mining and using a revolving screen, jigs and shaking tables for treating the ore, it was found that the ore particles were rather fine (53% passing 150 mesh). Tin losses to tailing were only at the particle size finer than 65 mesh.

After some development of the plant and treating the ore from the open cut, tin losses to tailing were very high (42 %). From the latest study, tin losses were much higher (more than 60 %) which could be explained to be due to two main causes. Firstly, there were locked tin particles with quartz which their sizes were larger than the screen holes of the jigs. Secondly, tightly packed jig bed in most part of the jigs which might be called "dead-packed jig" was another cause of tin losses. It was worth to note that tin losses to tailings were at all size.